

Elevated Voltage Report  
01/01/2008 - 03/31/2008

Report ID	Reported By	EV Date & Time	Contact Person	Contact Phone	TOWN	STREET	Impacted Equipment	Equipment Owner	Weather Condition	Voltage	Immediate Action	Repair Type	Post Mitigation Voltage	Date of Mitigation	INJURY	Asso. Accident ID	COMMENTS
136	Public	1/2/2008 13:26	Ross A Cox	508-897-5753	ANDOVER	HAVERHILL ST	ManHole	Company	Fair	2.5	Permanent Rep	Equip Other (use comments)	< 0.1 kV	1/2/2008	No		REPORT OF POSSIBLE DOG SHOCK CALLED IN AT INTERSECTION OF HAVERHILL ST 100' FROM MAIN ST MADE TEMPORY REPAIRS TO ST LIGHT CABLE ON RACK. Inspections department investigating Called customer and he stated that the dog appears to be fine. no issues have arisen from this incident. Customer Jason Bukowski (617)760-0673 if anything comes up he was told to let us know. Tim
138	Public	1/27/2008 23:31	Ross A Cox	508-897-5753	MALDEN	SALEM ST		Company	Fair	74	Temporary Rep	Photo Eye			No		Customer called to report dog was zapped at 280 Salem St (pole 4431). (This was 7:36 p.m. but the system would not allow me to put in the time, calling it future time). Tman confirmed pole was hot, pulled photocell, and reduced voltage to zero. The underground supervisor was notified and he'll have a crew to take care of the pole tomorrow (Monday 1/28). Inspections Department. Per Elaine Murphy the dogs owner is Jackie White and the Power on Number is 1061733 Andy Hadden was the UG supervisor on call and the Trouble worker was Pat Eisan on site. Call into John Leach regarding perm repairs will re-call on Tuesday
140	Public	3/24/2008 6:29	Ross A Cox	508-897-5753	WRENTHAM	SHELDON RD	Wood Pole	Company	Fair	0			< 0.1 kV	3/23/2008	No		Tman first reported there to be 6.3 volts on ROW pole 472 which is located behind house 180 Sheldon Rd in Wrentham MA. Tman was not checking voltage correctly. Using the proper equipment, a shunt resistor, the meter reading was 0 volts. Customer had reported her daughter to have received a shock. 03/24/08: Inspections Dept. investigation. Per Harvey Bertrand, On Call Supervisor: he assisted Lawrence Farnell, Tman, T #7978, with the investigation. PowerOn IS: #1081421.1. One Call IA: #29947. CSS Notes: 03/23/08 (5). 23kV / 2284 Feeder (P472.1) crosses under the 345kV / 303 Line P342.1 & P342.2 and 115kV / C129S Line P363.1 & P363.2. Photo's taken.

**Manhole Reports**  
**01/01/2008 - 03/31/2008**

Report ID	Manhole Report Type	Number of Customers Interrupted	Customer Outage Hours	Cause	Failure Date	Failure Time	Weather	Town	Street	Feeder	Voltage Class	Manhole Number	Date of Most Recent Manhole Inspection	Manhole Cover Type	Cover Dislodged? (Y/N)*	Failed Equipment Type	Estimated Age of Failed Equipment	Cable Type (if applicable)	Gas Detected	Injury (Y/N)	Associated Accident ID	Comments
1139	Smoking			Insulation failure - other	2/2/2008	3:02:34	Rain - light / moderate	FALL RIVER	DURFEE ST	106W42	W (13.80 kV)	5	10/17/2006	Solid	N	Joint	1950	PILC	N	No		17:21 NGRID GAS REPORTED M.H. SMOKING AT 111 DURFEE ST, 2/1/08. 2ND REPORT FROM 21:49 POLICE REPORTED 2ND LOCATION 134 DURFEE ST M.H. SMOKING. TMAN JOHN BOYKO CHECK NOTIFIED SPYR, MANNY COUTO. U.G WORKING AT VAULT 111 2.1. FOUND LEAD JOINTS AND WIRES BURNT SECONDARY CRIB. FURTHER INFORMATION CONTACT MANNY COUTO. POWER ON TICKET 1063584. 02/02/08 Inspections Dept. investigation. MH.5 Durfee St. Secondary 2/0 CU Quad. KDPS Lead. Secondary Lead Joint failed due to MH being filled with water. UG crew made repairs. The MH Cover was not dislodged.
1140	Smoking			Insulation failure - cable	2/27/2008	12:16:01	Fair	FALL RIVER	PLEASANT ST	106W42	W (13.80 kV)	49	2/27/2008	Solid	N	Cable	1950	PILC	N	No		NOTED PER CREW TERRY TRUCK 8464 REPORTED M.H.SMOKING: MH49 PLEASANT ST. FALL RIVER SECONDARY ARCING ACROSS ON STEPS (MOLES TRACKING)CALLED IN AT 12:09 TO LINCOLN SERVICE. 02/28/08: Inspections Dept. investigation. UG Crew taped up lead secondaries. No outage.
1141	Smoking			Insulation failure - cable	2/29/2008	8:40:27	Fair	LOWELL	MERRIMACK ST	10J1	J (4.16 kV)	32	2/29/2008	Solid	N	Cable	1965	PILC	N	No		Manhole 32 at Dutton & Market St Lowell blown cable joint causing manhole to smoke 133 feeder lockout. All customers were restored by manually Switching to alternate supplies. Power on order ID 1072544 1 IDS # 7344693
1142	Smoking			Unknown	3/21/2008	21:33:54	Rain - light / moderate	WORCESTER	CAMBRIDGE ST	4J339	J (4.16 kV)	1183	3/21/2008	Solid	N	Joint	1950	PILC	N	No		SWITCHING IN MANHOLE 1184, TIED TOGETHER THE 8J365 AND 4J339 CIRCUITS IN RESPONSE TO THE 4J339 FEEDER BEING LOCKED OUT. THIS CAUSED SMOKING IN MANHOLE 1183 WHICH RESULTED IN BOTH FEEDERS LOCKING OUT. WR # 4298954 created C phase locked out on 4J339 fault in manhole 1288 Cambridge St. at S. Cambridge. 12 ft. 4/0 EPR and 2 splices. 2 U/G crews with vans, e men, O & M crews and police detail.
1143	Smoking			Insulation failure - cable	3/28/2008	14:11:22	Freezing Rain or Sleet	WORCESTER	CHANDLER ST	1J363	J (4.16 kV)	2568	3/28/2008	Solid	N	Joint	1955	PILC	N	No		Report of a smoking manhole # 2568 at the intersection of May St & Chandler St on the 1J363 feeder. Their was a cable in the manhole with a blown joint causing it to smoke. 3/28/08: Inspections Dept. investigation. Power on # 1082585 WR # 4337849 created and job completed by worcester Underground crews no public contact
1144	Smoking			Flooding	3/31/2008	14:42:33	Rain - light / moderate	LAWRENCE	BROADWAY ST				3/31/2008			Joint	1955	XLP	N	No		393 Broadway st manhole steaming. street light wire in manhole. supervisor notified, crew sent to cut street light wire. Inspection Department. Power on # 1083216-1 Supervisor Brian hart on Job will supply a wr # on Tuesday